



Your Partner in Industrial Excellence

Enhance Your Production with Advanced Automation Solutions

Discover a wide range of high-quality industrial automation products and engineering services tailored to meet your specific needs. Our selection and expert services are designed to provide reliable, efficient solutions and support your operational goals.

For corporate inquiries, please contact us for detailed information.



Visit industify.com for more information, contact our support team, or email us at sales@industify.com

Single-Phase, Integrated Heatsink Type SSR

SRHL1 Series

[Left-Right Terminal]

Single-Phase, Integrated Heatsink Type SSR [Left-Right Terminal]

■ Features

- Zero cross turn-on, random turn-on models available
- Input indicator (green LED)
- Alarm function (overheat prevention)
 - Rated load current 10A/15A/20A/25A: alarm indicator (red LED)
 - Rated load current 40A: alarm indicator (red LED), alarm output
- DIN rail mount or panel mount installation

NEW



⚠ Please read "Safety considerations" in operation manual before using.

CE c **UL** US

■ Ordering Information

SRH	L	1	-	1	4	40		
								Function
								No mark
								R
								Rated input current (resistive load)
								10
								15
								20
								25
								40
								Rated load voltage
								2
								4
								Rated input voltage
								1
								4
								Control phase
								1
								Input/output terminal
								L
								Item
								SRH

Model	Rated input voltage	Rated load current	Rated load voltage	Function	Alarm (overheat prevention)
SRHL 1-1210	10-30VDC	10A	24-240VAC	Zero cross turn-on	Alarm indicator
SRHL 1-4210	90-240VAC	15A			Alarm indicator
SRHL 1-1215	10-30VDC				Alarm indicator
SRHL 1-4215	90-240VAC				Alarm indicator
SRHL 1-1220	10-30VDC	20A			Alarm indicator
SRHL 1-4220	90-240VAC	25A			Alarm indicator
SRHL 1-1225	10-30VDC				Alarm indicator
SRHL 1-4225	90-240VAC				Alarm indicator
SRHL 1-1240	10-30VDC	40A	48-480VAC	Zero cross turn-on Random turn-on	Alarm indicator +Alarm output
SRHL 1-4240	90-240VAC	10A			Alarm indicator
SRHL 1-1410	10-30VDC				Alarm indicator
SRHL 1-1410R	90-240VAC				Alarm indicator
SRHL 1-4410	90-240VAC	15A			Alarm indicator
SRHL 1-1415	10-30VDC				Alarm indicator
SRHL 1-1415R	90-240VAC				Alarm indicator
SRHL 1-4415	90-240VAC	20A			Alarm indicator
SRHL 1-1420	10-30VDC				Alarm indicator
SRHL 1-1420R	90-240VAC				Alarm indicator
SRHL 1-4420	90-240VAC	25A			Alarm indicator
SRHL 1-1425	10-30VDC				Alarm indicator
SRHL 1-1425R	90-240VAC				Alarm indicator
SRHL 1-4425	90-240VAC	40A			Alarm indicator +Alarm output
SRHL 1-1440	10-30VDC				Alarm indicator
SRHL 1-1440R	90-240VAC				Alarm indicator
SRHL 1-4440	90-240VAC		Alarm indicator		

(A) Photoelectric Sensors

(B) Fiber Optic Sensors

(C) Door/Area Sensors

(D) Proximity Sensors

(E) Pressure Sensors

(F) Rotary Encoders

(G) Connectors/ Connector Cables/ Sensor Distribution Boxes/Sockets

(H) Temperature Controllers

(I) SSRs / Power Controllers

(J) Counters

(K) Timers

(L) Panel Meters

(M) Tacho / Speed / Pulse Meters

(N) Display Units

(O) Sensor Controllers

(P) Switching Mode Power Supplies

(Q) Stepper Motors & Drivers & Controllers

(R) Graphic/ Logic Panels

(S) Field Network Devices

(T) Software

SRHL1 Series

■ Specifications

○ Input

Rated input voltage range	10-30VDC==	90-240VACrms~ (50/60Hz)
Allowable input voltage range	9-32VDC==	85-264VACrms~ (50/60Hz)
Max. input current	15mA	22mA
Pick-up voltage	Min. 9VDC==	Min. 85VACrms~
Drop-out voltage	Max. 1VDC==	Max. 10VACrms~
Turn-ON time	Zero cross turn-on Random turn-on	Max. 0.5 cycle of load source + 1ms Max. 1ms
Turn-off time	Max. 0.5 cycle of load source + 1ms	Max. 2 cycle of load source + 1ms

○ Output

Rated load voltage range	24-240VACrms ~ (50/60Hz)					48-480VACrms ~ (50/60Hz)					
Allowable load voltage range	24-264VACrms ~ (50/60Hz)					48-528VACrms ~ (50/60Hz)					
Rated load current	Resistive load (AC-51)*1	10Arms	15Arms	20Arms	25Arms	40Arms	10Arms	15Arms	20Arms	25Arms	40Arms
Min. load current		0.15Arms	0.15Arms	0.2Arms	0.2Arms	0.5Arms	0.5Arms	0.5Arms	0.5Arms	0.5Arms	0.5Arms
Max. 1 cycle surge current (60Hz)		160A	160A	250A	250A	400A	300A	300A	500A	500A	500A
Max. non-repetitive surge current (I ² t, t=8.3ms)		130A ² s	130A ² s	300A ² s	300A ² s	910A ² s	350A ² s	350A ² s	1000A ² s	1000A ² s	1000A ² s
Peak voltage (non-repetitive)		600V					1200V (Zero cross turn-on), 1000V (Random turn-on)				
Leakage current (Ta=25°C)		Max. 10mArms (240VAC~/60Hz)					Max. 10mArms (480VAC~/60Hz)				
Output on voltage drop [Vpk] (max. load current)		Max. 1.6V									
Static off state dv/dt		500V/μs									

*1: AC-51 is utilization category at IEC 60947-4-3.

○ Alarm output (overheat prevention)

Rated input voltage range	10-30VDC==	90-240VACrms~ (50/60Hz)
Load voltage	Max. 30VDC==	Max. 30VDC==
Load current	Max. 50mA	Max. 50mA
Turn-off time	Max. 50ms	Max. 100ms

※ Overheat prevention function: When SSR internal temperature is overheated, the load output is cut off to prevent internal device damage. The alarm indicator turns ON and alarm output turns ON.

※ Alarm output is only for the rated load current 40A model (SRHL1-□□□40□). In case of the rated load current 10A/15A/20A/25A models (SRHL1-□□□10□□□15□□□20□□□25□), the alarm indicator turns ON, regardless of alarm output.

※ To clear alarm, cut OFF the input signal during over alarm output return time at the rated ambient temperature.

○ General specifications

Dielectric strength (Vrms)	- Input-output: 2500VAC 50/60Hz for 1 min - Input/output-case: 4000VAC 50/60Hz for 1 min	
Insulation resistance	Over 100MΩ (at 500VDC megger) (input-output, input/output-case)	
Indicator	Input indicator: green LED, alarm indicator: red LED	
Vibration	Mechanical	0.75mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 1 hour
	Malfunction	0.5mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 10 min
Shock	Mechanical	300m/s ² (approx. 30G) in each X, Y, Z direction for 3 times
	Malfunction	100m/s ² (approx. 30G) in each X, Y, Z direction for 3 times
Environment	Ambient temperature	-30 to 70°C, storage: -30 to 100°C (The rated load current capacity is different depending on ambient temperature. Refer to '■ SSR Derating Curve'.)
	Ambient humidity	45 to 85%RH, storage: 45 to 85%RH
Input terminal connection, alarm output terminal connection	Min. 1×0.5mm ² (1×AWG20), max. 1×4mm ² (1×AWG12) or 2×1.5mm ² (2×AWG16)	
Output terminal connection	- Rated load current 10A/15A/20A/25A: min. 1×0.75mm² (1×AWG18), max. 1×6mm² (1×AWG10) or 2×2.5mm² (2×AWG14) - Rated load current 40A: min. 1×1.5mm² (1×AWG16), max. 1×16mm² (1×AWG6) or 2×6mm² (2×AWG10) ※ Use wires compliant with load current capacity to connect to the terminal.	
Input terminal fixed torque	0.75 to 0.95N·m	
Output terminal fixed torque	- Rated load current 10A/15A/20A/25A: 1.0 to 1.35N·m - Rated load current 40A: 1.6 to 2.2N·m	
Approval	CE 	
Weight*1	- Rated load current 10A/15A/20A/25A: approx. 270g (approx. 192g) - Rated load current 40A: approx. 468g (approx. 372g)	

*1: The weight includes packaging. The weight in parenthesis is for unit only.



※ Environment resistance is rated at no freezing or condensation.

※ For wiring the terminal, round terminal must be used.


Single-Phase, Integrated Heatsink Type SSR [Left-Right Terminal]

■ Dimensions

● Rated load current 10A/15A/20A/25A

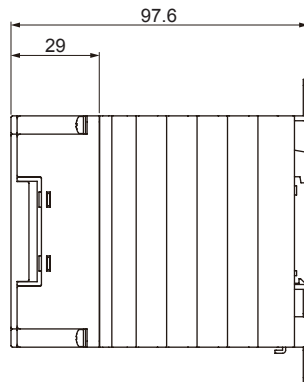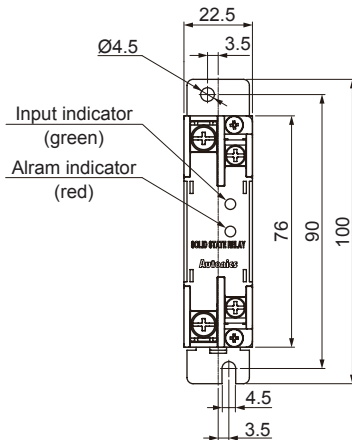



○ Panel cut-out

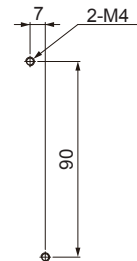

※Screw tightening torque for mounting
: 1.8 to 2.5N·m


(unit: mm)

● Rated load current 40A

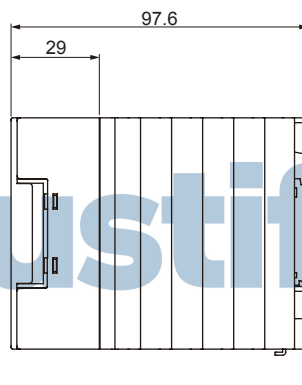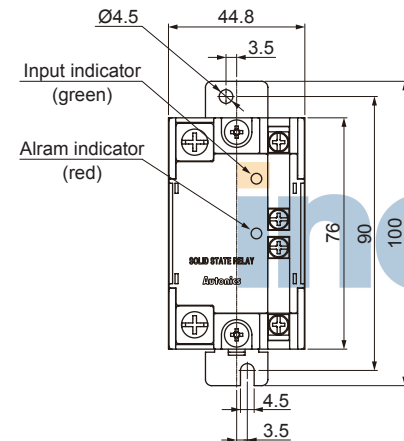


○ DIN rail mounting

● DIN rail attachment

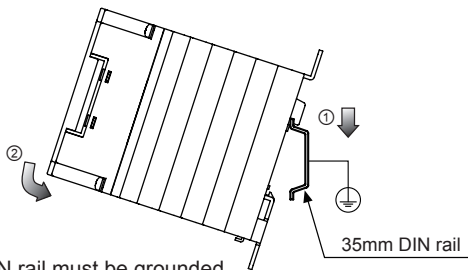


※DIN rail must be grounded.

● DIN rail detachment

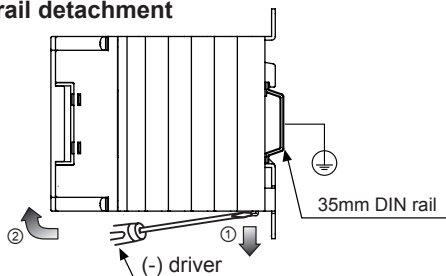

○ Spacing

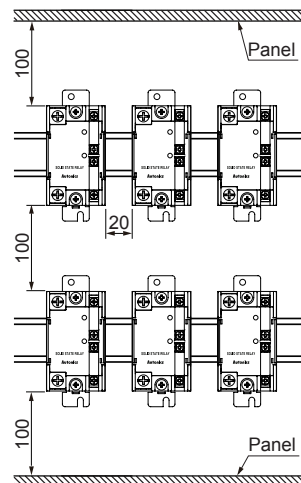

※When installing multiple SSRs, please keep space between SSRs for heat radiation. When installing SSRs horizontally (input part and output part on the same height), please supply less than 50% of the rated load current.




High temperature caution

While supplying power to the load or right after turning off the power of the load, do not touch the body and heat sink. Failure to follow this instruction may result in a burn due to the high temperature.

(A)	Photoelectric Sensors
(B)	Fiber Optic Sensors
(C)	Door/Area Sensors
(D)	Proximity Sensors
(E)	Pressure Sensors
(F)	Rotary Encoders
(G)	Connectors/ Connector Cables/ Sensor Distribution Boxes/Sockets
(H)	Temperature Controllers
(I)	SSRs / Power Controllers
(J)	Counters
(K)	Timers
(L)	Panel Meters
(M)	Tacho / Speed / Pulse Meters
(N)	Display Units
(O)	Sensor Controllers
(P)	Switching Mode Power Supplies
(Q)	Stepper Motors & Drivers & Controllers
(R)	Graphic/ Logic Panels
(S)	Field Network Devices
(T)	Software

SRHL1 Series

■ Connections

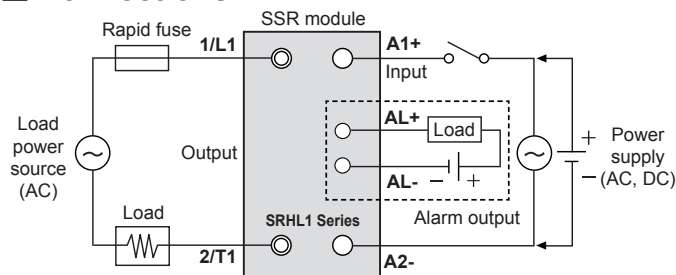


※Alarm output terminals (AL+ and AL-) are only for the rated load current 40A model (SRHL1-□□40□).
※Use terminals of size specified below.


Terminal type	Input, alarm output	Output
Rated load current	10A, 15A, 20A, 25A, 40A	10A, 15A, 20A, 25A 40A
	a Min. 3.5mm	Min. 4.0mm
b	Max. 7.0mm	Max. 9.0mm

■ SSR Derating Curve


◎ SRHL1-1210/1410/1410R/4210/4410

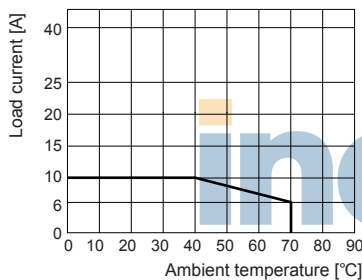


◎ SRHL1-1215/1415/1415R/4215/4415

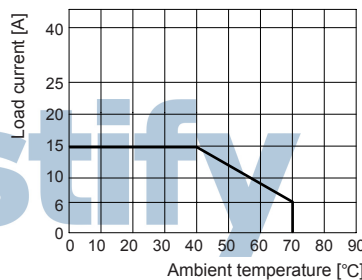


◎ SRHL1-1220/1420/1420R/4220/4420

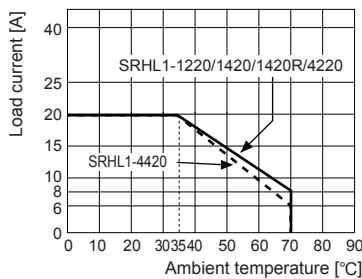

◎ SRHL1-1225/1425/1425R/4225/4425

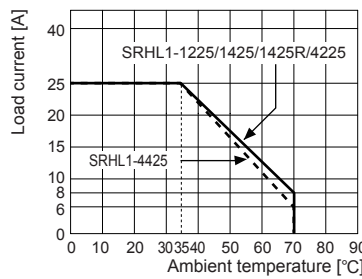

◎ SRHL1-1240/1440/1440R/4240/4440

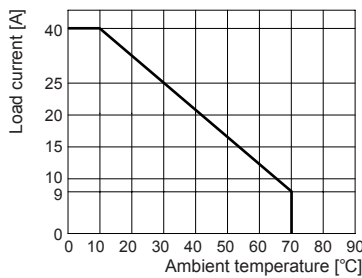

△ Since effectiveness of the heat radiation is decreased when multiple SSRs are installed closely, please supply less than 50% of the rated load current.

※Above SSR derating curves obtained approval from the UL certification authority.

Single-Phase, Integrated Heatsink Type SSR

[Left-Right Terminal]

■ Proper Usage

⚠ Cautions during use

1. Follow instructions in 'Cautions during use'. Otherwise, it may cause unexpected accidents.
2. 10-30VDC signal input should be insulated and limited voltage/current or Class 2, SELV power supply device.
3. Install the unit in the well ventilated place.
4. Ground to the heat sink, panel, or DIN rail.
Failure to follow this instruction may result in electric shock.
5. While supplying power to the load or right after turning off the power of the load, do not touch the body and heat sink.
Failure to follow this instruction may result in a burn due to the high temperature.
6. In order to protect the product from the short-circuit current of the load, use rapid fuse of which I^2t is under the 1/2 of SSR I^2t . When short-circuited, replace the fuse to those of same specification with the used rapid fuse.
7. Install dummy resistance in parallel with the load, to keep the sum of current flowing in the load and dummy resistance being over SSR minimum load current.
8. When using random turn-on model for phase control, install noise filter between the load and the power of the load.
9. Do not use near the equipment which generates strong magnetic force or high frequency noise.
10. This unit may be used in the following environments.
 - ① Indoors (in the environment condition rated in 'Specifications')
 - ② Altitude max. 2,000m
 - ③ Pollution degree 2
 - ④ Installation category III

industify

(A)	Photoelectric Sensors
(B)	Fiber Optic Sensors
(C)	Door/Area Sensors
(D)	Proximity Sensors
(E)	Pressure Sensors
(F)	Rotary Encoders
(G)	Connectors/ Connector Cables/ Sensor Distribution Boxes/Sockets
(H)	Temperature Controllers
(I)	SSRs / Power Controllers
(J)	Counters
(K)	Timers
(L)	Panel Meters
(M)	Tacho / Speed / Pulse Meters
(N)	Display Units
(O)	Sensor Controllers
(P)	Switching Mode Power Supplies
(Q)	Stepper Motors & Drivers & Controllers
(R)	Graphic/ Logic Panels
(S)	Field Network Devices
(T)	Software